



IMPORTANT SAFETY RECALL

This notice applies to your vehicle, VIN # 1HD

November 5, 2018

Harley-Davidson Recall No. 0173

NHTSA Recall No. 18V734

Dear Harley-Davidson Motorcycle Owner:

This notice is sent to you in accordance with the National Traffic and Motor Vehicle Safety Act.

Harley-Davidson Motor Company, Inc. has decided that a defect which relates to motor vehicle safety exists on 2017 Touring, CVO Touring and Trike; certain 2017 Softail and CVO Softail (FLSS, FLSTFBS, FXSE only); and 2018 Touring, CVO Touring and Trike. We are notifying you because our records indicate that you may own one of these motorcycles.

What is the Issue?

The hydraulic clutch system with secondary clutch actuator (part numbers 37200131 and 37200131A) may, on certain motorcycles, exhibit an internal leak of fluid past the secondary clutch actuator piston/seal. If this leak continues, the clutch master cylinder reservoir could lose enough fluid to expose the hydraulic clutch circuit to air, which may result in the inability to generate enough lift to disengage the clutch. This could lead to a loss of control of the vehicle when started in gear, first shifted into gear, or coming to a stop, increasing the risk of a crash.

What Should You Do?

Please contact your authorized Harley-Davidson motorcycle dealer immediately and arrange an appointment to have your motorcycle repaired. Your dealer will confirm that your motorcycle is covered by this recall. If covered, the dealer will perform the recall repair work using the recall kit provided by Harley-Davidson at no cost to you. The repair will take less than two hours to perform. However, due to scheduling, the dealer may require your motorcycle for a longer period